SERVICE DEPARTMENT BULLETIN

BULLETIN #91129

GENERAL CLASSIFICATION: Control Deck Repair
SPECIFIC SUBJECT: NES-CPU PCB (PART NO. 22667) 06 VERSION MODIFICATION

There is a possibility that circuit traces of the NES-CPU PCB 06 version will touch the upper or lower shield and cause a short circuit problem. To prevent this possibility, electrical tape must be applied to three locations on the PCB (refer to the figures below). For this application, the electrical tape should be rated UL-94 V-0.

Locations involving the problem:

1. Between the signal side trace of C33 and upper shield case.
2. Between the two through holes beside DA3, DA4, and upper shield case.
3. Between the four holes beside R3, R4, and lower shield case.
4. Between R9 and lower shield case.

Repair Action
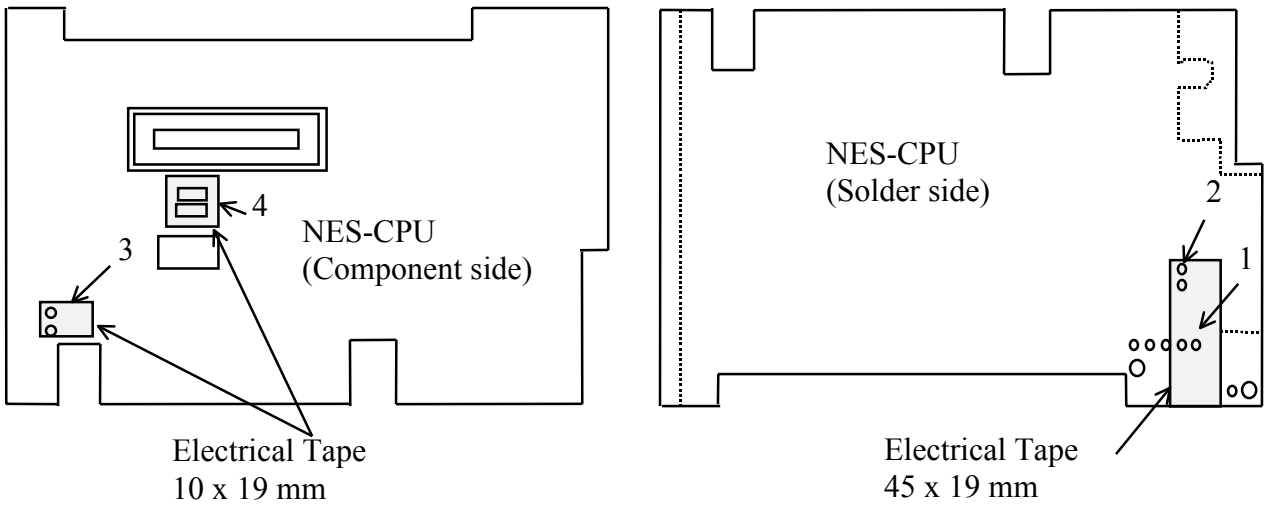
If product is in or out of warranty, perform modification as necessary. **Do not submit warranty claims for this modification.**